

DISPATCH

CLASSIFICATION

PROCESSING ACTION

~~SECRET~~

MARKED FOR INDEXING

TO

: Chief, OSA

NO INDEXING REQUIRED

INFO.

ONLY QUALIFIED DESK
CAN JUDGE INDEXING

FROM

: Acting Chief of Station, []

MICROFILM

25X1A

SUBJECT

Hangar Curtains for []

ACTION REQUIRED - REFERENCES

ATTENTION: []

1. During recent operations at [] the hangar curtains provided by [] proved inadequate. This failure can be directly attributed to (a) cables and turn-buckles were made of galvanized iron and not steel (b) curtain material was of a poor quality canvas (c) curtain eyelets were not adequately reinforced.

25X1A

2. The attached drawings are forwarded for your use in making up specifications for their manufacture in []

25X1A

3. FYI: Curtains are fastened to cables at top and bottom by "U" bolts and laced along their common sides by jute rope.

4. Present plans call for the erection of a 15ft brick wall at the rear of the hangar, which will provide some relief from the wind.

25X1A

Attachment: 1 Drawing

Distribution:

3 - OSA w/att. h/w

CROSS REFERENCE TO

DISPATCH SYMBOL AND NUMBER

DATE


30 June 1964

25X1A


CLASSIFICATION

HQ'S FILE NUMBER

~~SECRET~~



(SHOWING CLEARANCES THAT CAN BE ALLOWED FOR A 1500.00 HANGAR.)



LAY OUT PLAN

✓ CASE:- $\frac{1}{16}$ " TO 1-0"

25X1A

SID/-
EXECUTIVE ENGINEER
AVIATION DIVISION

SPECIFICATIONS:

1. 3" nylon webbing to be double stitched on both edges of webbing. *THIS WEBBING RUNS AROUND OUTSIDE OF EACH CURTAIN*
2. All seams to be 1" double folded and double stitched.
3. 1" nylon tape to be criss-crossed every 24" (approximately) single stitched on each edge of tape.
4. Install heavy duty gromets 12" apart all around each curtain.

GOVERNMENT FURNISHED MATERIAL:

1. Canvas. *S.N. 8305-170-5879*
2. Nylon webbing. *S.N. 8305-823-7176*
3. Nylon tape. *S.N. 8315-809-9398*

TO BE FURNISHED BY HOME SPORTING GOODS:

1. Heavy duty gromets.
2. Thread. *(HEAVY DUTY DAKRON)*
3. Labor and machines.

This project is covered under Government purchase order 9-3-47.

25X1A

Person to be contacted upon completion -

NOTE: Cost estimate to be obtained from

25X1A


by and funding approved by telephone prior to leaving material.

25X1A


XERO
COPY

XERO
COPY

XERO
COPY

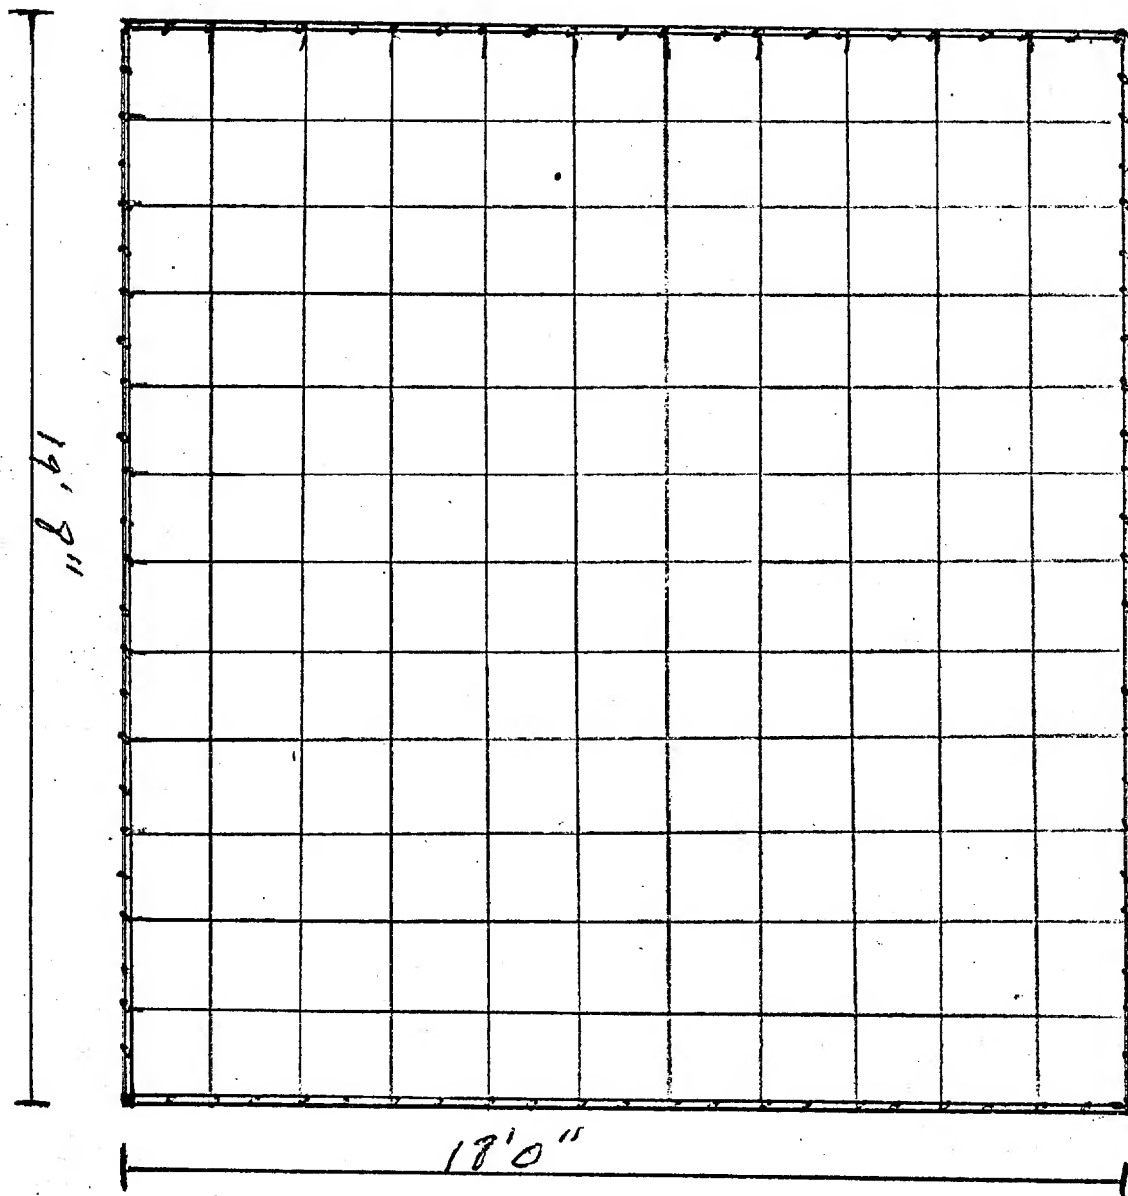

6 ea

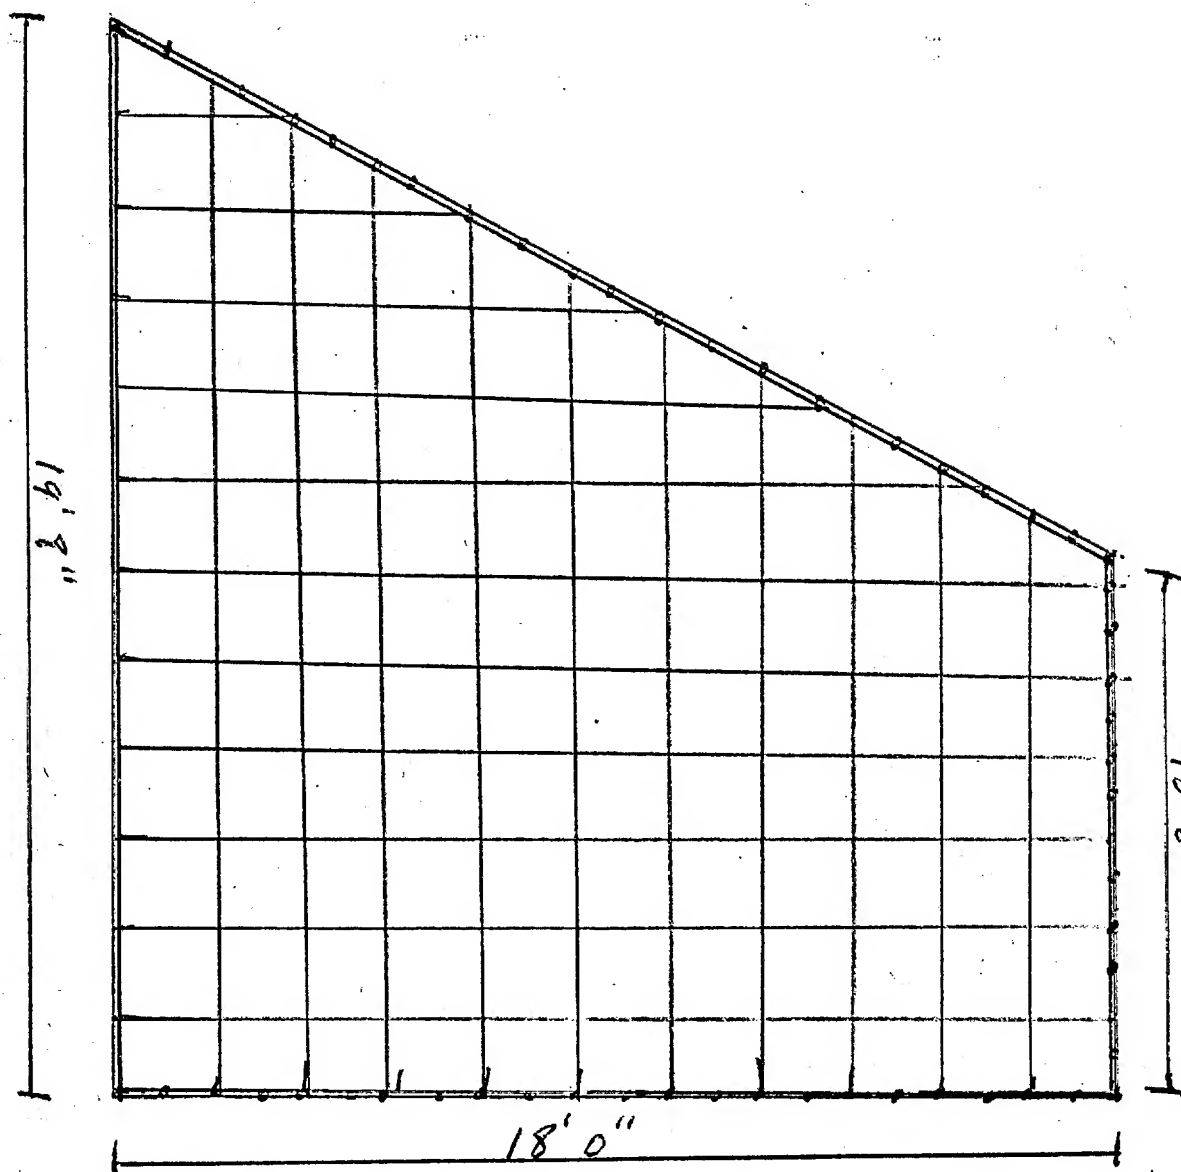

2 ea ONE RT. AND ONE LEFT.